

ERRATA NOTES

CC2430_CC2431

Table Of Contents

1	COMMAND STROBES CAN CORRUPT RX FIFO CONTENTS	.2
2	DOCUMENT HISTORY	4





1 Command Strobes Can Corrupt RX FIFO Contents


The following applies only when address decoding is enabled (MDMCTRL0H.ADDR_DECODE = 1).

1.1 Bug Description

When a frame is rejected by address decoding, CC2430 will disable SFD search until the frame has been completely received. This prevents detection of a false SFD within the remainder of the frame.

No part of the rejected frame should end up in the RX FIFO, but there is a special case where exactly one byte from the rejected frame gets written to the FIFO. This bug is triggered as follows:

- 1. Address decoding has failed, and CC2430 receives the remainder of the frame (SFD = 0).
- 2. An SRXON, STXON or SRFOFF strobe is executed in the same clock cycle as another byte of the rejected frame is received.
- 3. The last received byte of the rejected frame is written to the RX FIFO (byte "X" in the figure).

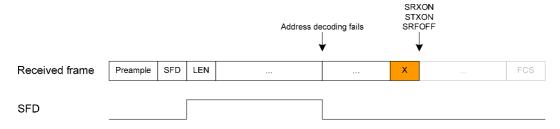

The following status values can be observed when the bug is triggered (not considering special conditions such as RX overflow):

- FIFO = 1
- FIFOP = 1 if byte "X" = 0x00 or 0x80

Both immediate strobes and strobes executed as CSP instructions are affected.

1.2 Suggested Workaround

The proposed workaround is simple to implement and has few negative side-effects.

SRXON and SRFOFF

The workaround consists of flushing the RX FIFO after the strobe has been executed.

The following procedure reduces the risk of false bug detection:





```
// Record the number of bytes in the RX FIFO before the strobe
rxfifocntBefore = RXFIFOCNT;
RFST = ISRFOFF; // or SRXON

// There is a short delay from the strobe until RXFIFOCNT has been updated.
... Wait for 0.75 us or more ...

// If RXFIFOCNT changed during the last operation, it is very

// likely that the bug has occurred
if (RXFIFOCNT != rxfifocntBefore) {
    // Flush twice, as described in the data sheet
    SFLUSHRX();
    SFLUSHRX();
    // Software clean-up
    ... Reset software for frame reception, and abort DMA if necessary ...
}
```

STXON

A CCA check will always fail during the critical period, from a frame is rejected until it is completely removed. The bug will never occur when CCA is checked immediately (less than the time it takes to receive one byte) before STXON.

For transmission without CCA checking, the receiver must be turned off before STXON is strobed from software, or before the CSP program (containing STXON) is started. Use the procedure described above when strobing SRFOFF to disable the receiver.

Note:

- SRXON and SRFOFF cannot be used safely in a CSP program to reduce power consumption during CSMA-CA unless all data received during this period is discarded manually by software. However, if SRXON and SRFOFF are used during CSMA-CA, it is probably not expected to receive that much data anyway.
- When flushing the RX FIFO, received frames still to be read out will be lost. There is
 also a chance that the lost frames may already have been acknowledged. The effect
 is that the transmitter gets a false acknowledgment in return, but this is likely to
 happen sooner or later anyway (the only thing that separates one acknowledgment
 frame from another is the 8-bit sequence number).

1.3 Batches Affected

This bug affects all batches and revisions of the chip.





2 Document History

Revision	Date	Description/Changes
SWRZ021	2007-07-25	Initial Release

TEXAS INSTRUMENTS NORWAY

Tel. +47-22958544

Fax +47-22958546

www.ti.com

IMPORTANT NOTICE

Texas Instruments Incorporated and its subsidiaries (TI) reserve the right to make corrections, modifications, enhancements, improvements, and other changes to its products and services at any time and to discontinue any product or service without notice. Customers should obtain the latest relevant information before placing orders and should verify that such information is current and complete. All products are sold subject to TI's terms and conditions of sale supplied at the time of order acknowledgment.

TI warrants performance of its hardware products to the specifications applicable at the time of sale in accordance with TI's standard warranty. Testing and other quality control techniques are used to the extent TI deems necessary to support this warranty. Except where mandated by government requirements, testing of all parameters of each product is not necessarily performed.

TI assumes no liability for applications assistance or customer product design. Customers are responsible for their products and applications using TI components. To minimize the risks associated with customer products and applications, customers should provide adequate design and operating safeguards.

TI does not warrant or represent that any license, either express or implied, is granted under any TI patent right, copyright, mask work right, or other TI intellectual property right relating to any combination, machine, or process in which TI products or services are used. Information published by TI regarding third-party products or services does not constitute a license from TI to use such products or services or a warranty or endorsement thereof. Use of such information may require a license from a third party under the patents or other intellectual property of the third party, or a license from TI under the patents or other intellectual property of TI.

Reproduction of TI information in TI data books or data sheets is permissible only if reproduction is without alteration and is accompanied by all associated warranties, conditions, limitations, and notices. Reproduction of this information with alteration is an unfair and deceptive business practice. TI is not responsible or liable for such altered documentation. Information of third parties may be subject to additional restrictions.

Resale of TI products or services with statements different from or beyond the parameters stated by TI for that product or service voids all express and any implied warranties for the associated TI product or service and is an unfair and deceptive business practice. TI is not responsible or liable for any such statements.

TI products are not authorized for use in safety-critical applications (such as life support) where a failure of the TI product would reasonably be expected to cause severe personal injury or death, unless officers of the parties have executed an agreement specifically governing such use. Buyers represent that they have all necessary expertise in the safety and regulatory ramifications of their applications, and acknowledge and agree that they are solely responsible for all legal, regulatory and safety-related requirements concerning their products and any use of TI products in such safety-critical applications, notwithstanding any applications-related information or support that may be provided by TI. Further, Buyers must fully indemnify TI and its representatives against any damages arising out of the use of TI products in such safety-critical applications.

TI products are neither designed nor intended for use in military/aerospace applications or environments unless the TI products are specifically designated by TI as military-grade or "enhanced plastic." Only products designated by TI as military-grade meet military specifications. Buyers acknowledge and agree that any such use of TI products which TI has not designated as military-grade is solely at the Buyer's risk, and that they are solely responsible for compliance with all legal and regulatory requirements in connection with such use.

TI products are neither designed nor intended for use in automotive applications or environments unless the specific TI products are designated by TI as compliant with ISO/TS 16949 requirements. Buyers acknowledge and agree that, if they use any non-designated products in automotive applications, TI will not be responsible for any failure to meet such requirements.

Following are URLs where you can obtain information on other Texas Instruments products and application solutions:

	Applications	
amplifier.ti.com	Audio	www.ti.com/audio
dataconverter.ti.com	Automotive	www.ti.com/automotive
dsp.ti.com	Broadband	www.ti.com/broadband
interface.ti.com	Digital Control	www.ti.com/digitalcontrol
logic.ti.com	Military	www.ti.com/military
power.ti.com	Optical Networking	www.ti.com/opticalnetwork
microcontroller.ti.com	Security	www.ti.com/security
www.ti-rfid.com	Telephony	www.ti.com/telephony
www.ti.com/lpw	Video & Imaging	www.ti.com/video
	Wireless	www.ti.com/wireless
	dataconverter.ti.com dsp.ti.com interface.ti.com logic.ti.com power.ti.com microcontroller.ti.com www.ti-rfid.com	amplifier.ti.com dataconverter.ti.com dsp.ti.com interface.ti.com logic.ti.com power.ti.com microcontroller.ti.com www.ti-rfid.com www.ti-com/lpw Audio Automotive Broadband Digital Control Military Optical Networking Security Telephony Video & Imaging

Mailing Address: Texas Instruments, Post Office Box 655303, Dallas, Texas 75265 Copyright © 2007, Texas Instruments Incorporated