
Instructions

# Instructions for Installation, Use and Maintenance of 3M Cable Shear Model 3320

Please Note: This unit has been designed specifically for cutting 3M flat cable. When used for this purpose it will provide excellent service and require a minimum of maintenance. Due to the specialized nature of the design, it should not be used for cutting other materials.

The 3320 Cable Shear is supplied with one section of table assembled to the shear and the following accessories:

| Qty | Item                            |
|-----|---------------------------------|
| 1   | Cable stop                      |
| 2   | Tapes (1-U.S. inch; 1-metric)   |
| 2   | Long table support legs (black) |
| 2   | Short table support legs (red)  |
| 4   | 1/4-20 nuts                     |
| 2   | 10 - 32 x 5/8" flat head screws |

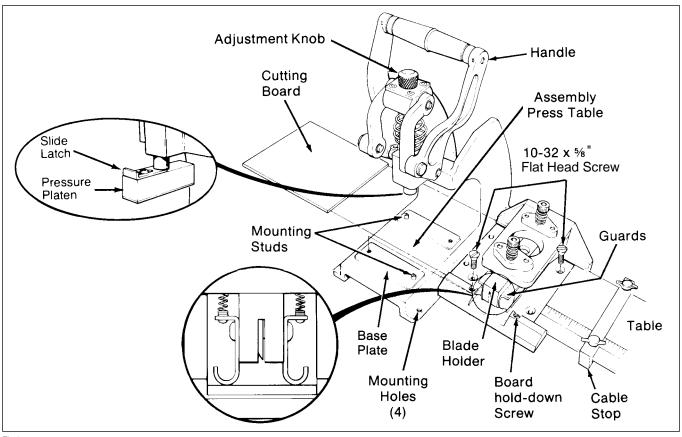

# Press Set-up

(figure 1).

- 1. Remove pressure platen from assembly press.
- 2. Place a 1/4" thick plate of any rigid material on the assembly press table. Many 3M connector locator plates are 1/4" thick, but thickness must be verified.
- 3. Adjust any 3M assembly press to a shut height gauge setting of 15 1/2 following the instructions provided with the assembly press. Use Shut Height Gauge 3436-1A. (Setting is made with the gauge block resting on the 1/4" base plate.)

# **Shear Installation:**

(figure 1).

- 1. Place the shear in the 3M assembly press, locating it over the existing mounting studs.
- If a more permanent installation is desired, the shear can be fastened down using the two 10-32 x 5/8" flat head screws provided.
  - Loosen the cutting board hold down screw and slide the cutting board out.
  - b. Install the two 10-32 x 5/8" flat head screws in the shear in the two remaining holes where the locating pins are **not** showing.
  - Replace cutting board and tighten the hold-down screw.

# Table Assembly:

The table can be extended to any desired length by adding more 3320-1 table assemblies.

### **Joining Additional Tables**

- 1. Select the proper table support legs; **long (black)** if the shear is to be used on the 3335 series or 3339 series heavy duty presses, or **short (red)** if the shear is to be used on the 3640 or 3440-A standard assembly press.
- 2. Thread a 1/4 20 nut onto each of the table support legs, down to where approximately 3/8" of thread is exposed beyond the nut (figure 2a).

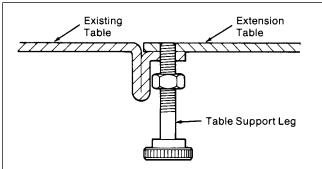


Fig. 2a

- 3. Place the extension table over the end of the existing table, aligning the mating holes.
- 4. Thread the table support legs, from the bottom, through the existing table and into the extension table, until the legs are flush with the extension table top.
- 5. Thread the nuts toward the table and tighten, securing the two tables into place (figure 2b).

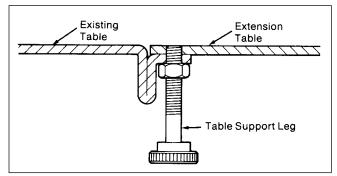


Fig. 2b

Repeat steps #1 through #5 for each additional table length.

### **Assembling Final Table**

- 1. Repeat steps #1 and #2 above.
- 2. Place the table support legs into the holes at the end of the table.
- 3. Thread a 1/4 20 nut onto the exposed thread of the table support leg and tighten (figure 2c).

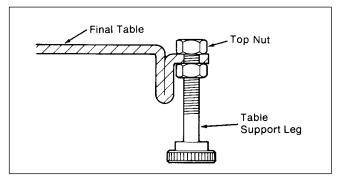


Fig. 2c

### **Measuring Tape Installation**

- 1. Select desired tape, U.S. inch or metric.
- 2. Unwind the first 1-1/2 feet (45.72 cm) of tape.
- 3. Slide the tape under the plastic guards aligning a 12 inch mark (30 cm mark) directly under the blade, at least 1/2 inch (1.27 cm) from either edge of the table (figure 3).

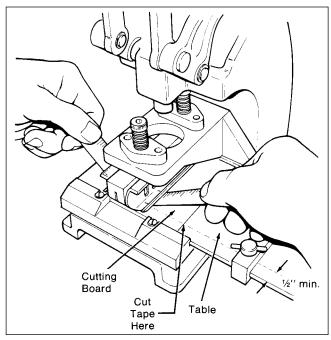


Fig. 3

- 4. Press the tape down onto the table, the length as required by the number of table assemblies installed.
- 5. Cut the tape along the edge of the table where the cutting board meets the table and remove the tape from the cutting board.

Note: The tape is made with a surface suitable for ink marking so additional numbers can be added as desired.

# Operation:

### Use:

- Move the cable stop along the table until the left side is set for the proper cable length; tighten the two set screws.
- 2. Insert cable from either side or the front of the shear.
- 3. Guide cable along either the front or rear edge of the shear to obtain proper alignment, assuring a right angle cut.
- 4. Depress the assembly press handle until the arms stop against the casting. If the cable is not fully sheared or excessive pressure is required, fine-tune the shut height setting to correct.
- 5. Subsequent cuts can be made by feeding the cable through the shear to the desired length.

**Note:** When shearing very thick cable, it is necessary to use the incoming cable to push the cut cable out so the plastic guard does not drop. If a problem is encountered in inserting cable from side, insert from the front.

## Maintenance:

### Cutting Board (Replacement Board 3457-2)

- When a clean cut is no longer obtainable, loosen the cutting board hold down screw, move the board 1/16" to the left and tighten the screw. The board can also be turned 180° for more use of one side, then turned over and the procedure repeated.
- Replacement boards are available and can be installed as in #1 above.

# Cutting Blade (Replacement Blade 3449-6 )

- Depress the assembly press handle until the arms stop against the casting. The two set-screws are now visible through the plastic guard on the right side of the blade holder.
- 2. With a 3/32" allen wrench, loosen the two set screws (figure 4).
- Release the assembly press handle and remove the old blade.
- 4. With the press handle most of the way down, slide a new blade into the slot from the front. (Use the old blade to push the new one into place, centering the blade over the cutting board.)
- 5. When blade is properly located, depress the press handle until the arms stop against the casting.
- 6. Tighten the two blade holding set screws.

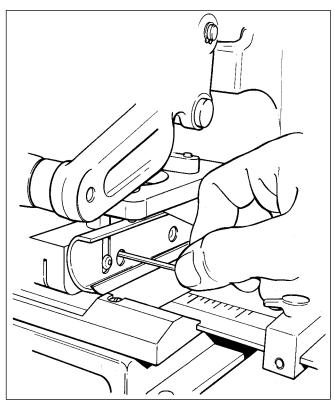


Fig. 4

# Call 800-225-5373

for sales, ordering or technical information

### **Important Notice:**

All statements, technical information and recommendations related to the Seller's products are based on information believed to be reliable, but the accuracy or completeness thereof is not guaranteed. Before utilizing the product, the user should determine the suitability of the product for its intended use. The user assumes all risks and liability whatsoever in connection with such use.

Any statements or recommendations of the Seller which are not contained in the Seller's current publications shall have no force or effect unless contained in an agreement signed by an authorized officer of the Seller. The statements contained herein are made in lieu of

all warranties, express or implied, including but not limited to the implied warranties of merchantability and fitness for a particular purpose which warranties are hereby expressly disclaimed.

SELLER SHALL NOT BE LIABLE TO THE USER OR ANY OTHER PERSON UNDER ANY LEGAL THEORY, INCLUDING BUT NOT LIMITED TO NEGLIGENCE OR STRICT LIABILITY, FOR ANY INJURY OR FOR ANY DIRECT OR CONSEQUENTIAL DAMAGES SUSTAINED OR INCURRED BY REASON OF THE USE OF ANY OF THE SELLER'S PRODUCTS THAT WERE DEFECTIVE.

**34-7013-8616-0** ©1993 3M

