

# S101DH2 Series S201DH2 Series

\*Non-zero cross type is also available. (S101DH1 Series/ S201DH1 Series)

I<sub>T</sub>(rms)≤1.5A, Zero Cross type **DIP 16pin Triac output SSR** 



#### Description

S101DH2 Series and S201DH2 Series Solid State Relays (SSR) are an integration of an infrared emitting diode (IRED), a Phototriac Detector and a main output Triac. These devices are ideally suited for controlling high voltage AC loads with solid state reliability while providing 4.0kV isolation (V<sub>iso</sub>(rms)) from input to output.

#### Features

- 1. Output current, I<sub>T</sub>(rms)≤1.5A
- 2. Zero crossing functionary
- 3. 16 pin DIP package
- 4. High repetitive peak off-state voltage (V<sub>DRM</sub> : 600V, S201DH2 Series) (V<sub>DBM</sub> : 400V, S101DH2 Series)
- 5. Superior noise immunity (dV/dt : MIN. 200V/µs, S101DH2 Series) (dV/dt : MIN. 100V/µs, S201DH2 Series)
- 6. Response time, ton : MAX. 100µs
- 7. Lead-free terminal components are also available (see Model Line-up section in this datasheet)
- 8. High isolation voltage between input and output  $(V_{iso}(rms) : 4.0kV)$

#### Agency approvals/Compliance

- 1. Recognized by UL508, file No. E94758 (as model No. S101DH2/S201DH2)
- 2. Approved by CSA 22.2 No.14, file No. LR63705 (as model No. S101DH2/S201DH2)
- 3. Package resin : UL flammability grade (94V-0)

#### Applications


- 1. Isolated interface between high voltage AC devices and lower voltage DC control circuitry.
- 2. Switching motors, fans, heaters, solenoids, and valves.
- 3. Power control in applications such as lighting and temperature control equipment.

Notice The content of data sheet is subject to change without prior notice

In the absence of confirmation by device specification sheets, SHARP takes no responsibility for any defects that may occur in equipment using any SHARP devices shown in catalogs, data books, etc. Contact SHARP in order to obtain the latest device specification sheets before using any SHARP device.




## Internal Connection Diagram

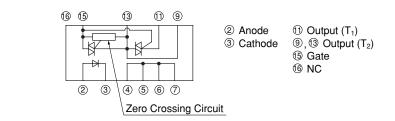

## Outline Dimensions

(Unit : mm)

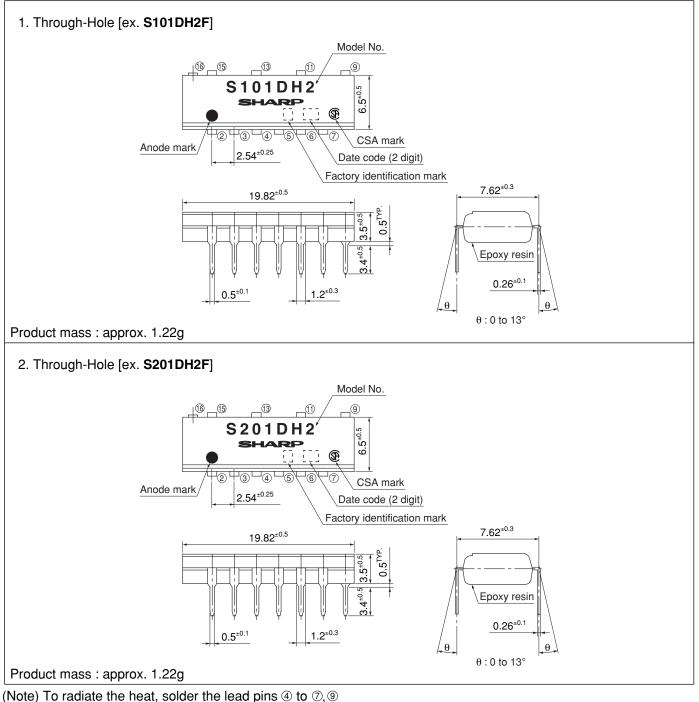

on the pattern of the PCB without using a socket such that there is no open pin left.



#### Date code (2 digit)

1st o	digit		2nd digit		
Year of production			Month of production		
Mark	A.D	Mark	Month	Mark	
А	2002	Р	January	1	
В	2003	R	February	2	
С	2004	S	March	3	
D	2005	Т	April	4	
Е	2006	U	May	5	
F	2007	V	June	6	
Н	2008	W	July	7	
J	2009	X	August	8	
K	2010	А	September	9	
L	2011	В	October	0	
М	2012	С	November	N	
N	:		December	D	
	Year of p Mark A B C D E F H J K J K L M	Mark A.D   A 2002   B 2003   C 2004   D 2005   E 2006   F 2007   H 2008   J 2009   K 2010   L 2011   M 2012	Year of production   Mark A.D Mark   A 2002 P   B 2003 R   C 2004 S   D 2005 T   E 2006 U   F 2007 V   H 2008 W   J 2009 X   K 2010 A   L 2011 B   M 2012 C	Year of production Month of   Mark A.D Mark Month   A 2002 P January   B 2003 R February   C 2004 S March   D 2005 T April   E 2006 U May   F 2007 V June   H 2008 W July   J 2009 X August   K 2010 A September   L 2011 B October   M 2012 C November	

repeats in a 20 year cycle

#### Factory identification mark

Factory identification Mark	Country of origin
no mark	Inner
	Japan


\* This factory marking is for identification purpose only. Please contact the local SHARP sales representative to see the actural status of the production.

#### Rank mark

There is no rank mark indicator and currently there are no rank offered for this device.

#### ■ Absolute Maximum Ratings

<b>Absolute Maximum Ratings</b> $(T_a=25^{\circ}C)$							
	Parameter	Symbol	Rating	Unit			
Turnet	Forward current	I <sub>F</sub>	50 * <sup>3</sup>	mA			
Input	Reverse voltage	VR	V <sub>R</sub> 6				
	RMS ON-state curren	I <sub>T</sub> (rms)	1.5 *3	А			
Output	Peak one cycle surge	I <sub>surge</sub>	15 *4	А			
	Repetitive peak	S101DH2		400	V		
	OFF-state voltage	S201DH2	V DRM	600	v		
*1Isolatio	on voltage	V <sub>iso</sub> (rms)	4.0	kV			
Operati	ing temperature	T <sub>opr</sub>	-25 to +85	°C			
Storage	e temperature	T <sub>stg</sub>	-40 to +125	°C			
*2Solderi	ng temperature	T <sub>sol</sub>	260	°C			



\*1 40 to 60%RH, AC for 1minute, f=60Hz

\*2 For 10s

\*3 Refer to Fig.1, Fig.2 \*4 f=50Hz sine wave

## Electro-optical Characteristics

 $(T_a=25^{\circ}C)$ 

Parameter		Symbol	Conditions	MIN.	TYP.	MAX.	Unit	
T	Forward voltage		$V_{\rm F}$	I <sub>F</sub> =20mA	-	1.2	1.4	V
Input	Reverse current		IR	V <sub>R</sub> =3V	_	-	10	μΑ
	Repetitive peak OFF-state current		I <sub>DRM</sub>	$V_D = V_{DRM}$	_	-	100	μΑ
Output	ON-state voltage		VT	I <sub>T</sub> =1.5A	-	-	1.7	V
	Holding current		I <sub>H</sub>	V <sub>D</sub> =6V	-	-	25	mA
	Critical rate of rise of	S101DH2	dV/dt	$V_{\rm D}=1/\sqrt{2} \cdot V_{\rm DRM}$	200	-	-	V/µs
	OFF-state voltage	S201DH2	u v/ui		100	_	-	v/µs
	Zero cross voltage		Vox	IF=15mA, Resistance load	_	_	35	V
Transfer charac- teristics	Minimum trigger current		Ift	$V_D=6V, R_L=100\Omega$	_	-	10	mA
	Isolation resistance		Riso	DC500V,40 to 60%RH	$5 \times 10^{10}$	1011	-	Ω
	Turn-on time		ton	VD=6V, RL=100Ω, IF=20mA	-	-	100	μs



#### ■ Model Line-up (1) (Lead-free terminal components)

Lead Form	Form Through-Hole		I <sub>FT</sub> [mA]
Shipping Package	Sleeve	V <sub>DRM</sub>	$(V_D=6V,$
	25pcs/sleeve	[V]	$R_L=100\Omega)$
Model No.	S101DH2F	400	MAX.10
	S201DH2F	600	MAX.10


### ■ Model Line-up (2) (Lead solder plating components)

Lead Form	Through-Hole		I <sub>FT</sub> [mA]
Shipping Package	Sleeve		$(V_D=6V,$
	25pcs/sleeve	[V]	$R_L=100\Omega)$
Model No.	S101DH2	400	MAX.10
	S201DH2	600	MAX.10


Please contact a local SHARP sales representative to see the actual status of the production.



Fig.1 Forward Current vs. Ambient Temperature

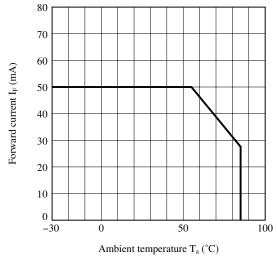

## Fig.3 Forward Current vs. Forward Voltage

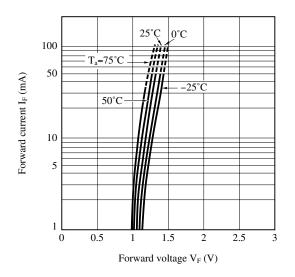

#### Fig.5 ON-state Voltage vs. Ambient Temperature


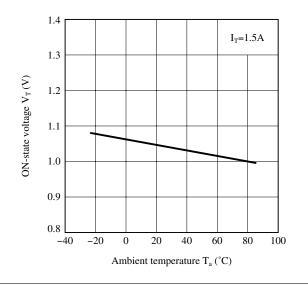


Fig.2 RMS ON-state Current vs. Ambient Temperature

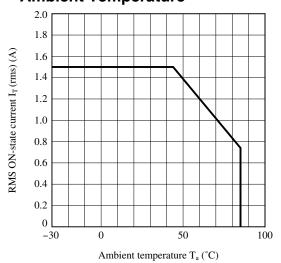

#### Fig.4 Minimum Trigger Current vs. Ambient Temperature


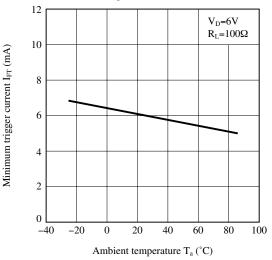



Fig.6 Relative Holding Current vs. Ambient Temperature



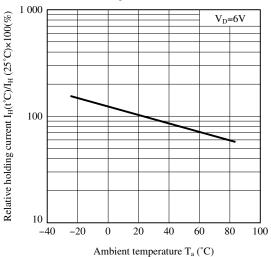

## Fig.7 ON-state Current vs. ON-state Voltage

## Fig.8 Turn-on Time vs. Forward Current

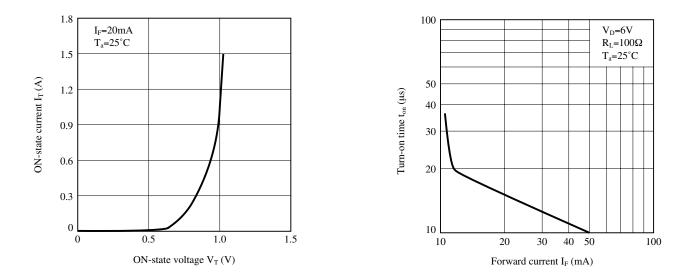

Remarks : Please be aware that all data in the graph are just for reference.



# Design Considerations

#### • Recommended Operating Conditions

Parameter		Symbol	Conditions		MAX.	Unit	
Input signal current at ON state		$I_F(ON)$	_		25	mA	
Input	Input signal current at OFF state		$I_F(OFF)$	_	0	0.1	mA
Output	Lood gumply voltage	S101DH2	V <sub>OUT</sub> (rms)		_	120	V
		S201DH2		-		240	
	Load supply current		I <sub>OUT</sub> (rms)	Locate snubber circuit between output terminals (Cs= $0.022\mu$ F, Rs= $47\Omega$ )	_	I <sub>T</sub> (rms)×80%(*)	mA
	Frequency		f	_	50	60	Hz
Operating temperature		T <sub>opr</sub>	_	-20	80	°C	

(\*) See Fig.2 about derating curve (I<sub>T</sub>(rms) vs. ambient temperature).

## Design guide

In order for the SSR to turn off, the triggering current  $(I_F)$  must be 0.1mA or less.

Particular attention needs to be paid when utilizing SSRs that incorporate zero crossing circuitry. If the phase difference between the voltage and the current at the output pins is large enough, zero crossing type SSRs cannot be used. The result, if zero crossing SSRs are used under this condition, is that the SSR may not turn on and off irregardless of the input current. In this case, only a non zero cross type SSR should be used in combination with the above mentioned snubber circuit selection process.

When the input current (I<sub>F</sub>) is below 0.1mA, the output Triac will be in the open circuit mode. However, if the voltage across the Triac, V<sub>D</sub>, increases faster than rated dV/dt, the Triac may turn on. To avoid this situation, please incorporate a snubber circuit. Due to the many different types of load that can be driven, we can merely recommend some circuit values to start with : Cs=0.022 $\mu$ F and Rs=47 $\Omega$ . The operation of the SSR and snubber circuit should be tested and if unintentional switching occurs, please adjust the snubber circuit component values accordingly.

When making the transition from On to Off state, a snubber circuit should be used ensure that sudden drops in current are not accompanied by large instantaneous changes in voltage across the Triac. This fast change in voltage is brought about by the phase difference between current and voltage. Primarily, this is experienced in driving loads which are inductive such as motors and solenods. Following the procedure outlined above should provide sufficient results.

For over voltage protection, a Varistor may be used.

Any snubber or Varistor used for the above mentioned scenarios should be located as close to the main output triac as possible.

All pins shall be used by soldering on the board. (Socket and others shall not be used.)

## Degradation


In general, the emission of the IRED used in SSR will degrade over time.

In the case where long term operation and / or constant extreme temperature fluctuations will be applied to the devices, please allow for a worst case scenario of 50% degradation over 5years.

Therefore in order to maintain proper operation, a design implementing these SSRs should provide at least twice the minimum required triggering current from initial operation.



### Standard Circuit

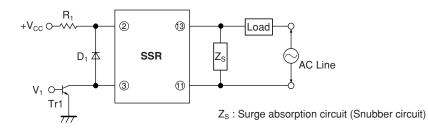

☆ For additional design assistance, please review our corresponding Optoelectronic Application Notes.



## Manufacturing Guidelines

## Soldering Method

Flow Soldering :

Flow soldering should be completed below 260°C and within 10s. Preheating is within the bounds of 100 to 150°C and 30 to 80s. Please solder within one time.

## Hand soldering

Hand soldering should be completed within 3s when the point of solder iron is below  $400^{\circ}$ C. Please solder within one time.

## Other notices

Please test the soldering method in actual condition and make sure the soldering works fine, since the impact on the junction between the device and PCB varies depending on the tooling and soldering conditions.



#### • Cleaning instructions

Solvent cleaning :

Solvent temperature should be 45°C or below. Immersion time should be 3minutes or less.

#### Ultrasonic cleaning :

The impact on the device varies depending on the size of the cleaning bath, ultrasonic output, cleaning time, size of PCB and mounting method of the device.

Therefore, please make sure the device withstands the ultrasonic cleaning in actual conditions in advance of mass production.

#### Recommended solvent materials :

Ethyl alcohol, Methyl alcohol and Isopropyl alcohol.

In case the other type of solvent materials are intended to be used, please make sure they work fine in actual using conditions since some materials may erode the packaging resin.

#### • Presence of ODC

This product shall not contain the following materials.

And they are not used in the production process for this device.

Regulation substances : CFCs, Halon, Carbon tetrachloride, 1.1.1-Trichloroethane (Methylchloroform) Specific brominated flame retardants such as the PBBOs and PBBs are not used in this product at all.



## Package specification

## • Sleeve package

### Through-Hole

Package materials Sleeve : HIPS (with anti-static material) Stopper : Styrene-Elastomer

#### Package method


MAX. 25pcs of products shall be packaged in a sleeve.

Both ends shall be closed by tabbed and tabless stoppers.

The product shall be arranged in the sleeve with its anode mark on the tabless stopper side.

MAX. 20 sleeves in one case.

#### Sleeve outline dimensions

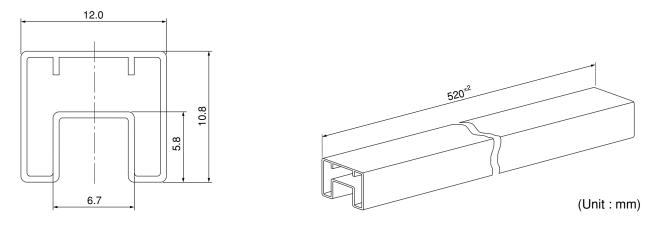

## SHARP

#### Important Notices

• The circuit application examples in this publication are provided to explain representative applications of SHARP devices and are not intended to guarantee any circuit design or license any intellectual property rights. SHARP takes no responsibility for any problems related to any intellectual property right of a third party resulting from the use of SHARP's devices.

• Contact SHARP in order to obtain the latest device specification sheets before using any SHARP device. SHARP reserves the right to make changes in the specifications, characteristics, data, materials, structure, and other contents described herein at any time without notice in order to improve design or reliability. Manufacturing locations are also subject to change without notice.

· Observe the following points when using any devices in this publication. SHARP takes no responsibility for damage caused by improper use of the devices which does not meet the conditions and absolute maximum ratings to be used specified in the relevant specification sheet nor meet the following conditions:

(i) The devices in this publication are designed for use in general electronic equipment designs such as:

- --- Personal computers
- --- Office automation equipment
- --- Telecommunication equipment [terminal]
- --- Test and measurement equipment
- --- Industrial control
- --- Audio visual equipment
- --- Consumer electronics

(ii) Measures such as fail-safe function and redundant design should be taken to ensure reliability and safety when SHARP devices are used for or in connection with equipment that requires higher reliability such as:

- --- Transportation control and safety equipment (i.e., aircraft, trains, automobiles, etc.)
- --- Traffic signals
- --- Gas leakage sensor breakers
- --- Alarm equipment
- --- Various safety devices, etc.

(iii) SHARP devices shall not be used for or in connection with equipment that requires an extremely high level of reliability and safety such as:

- --- Space applications
- --- Telecommunication equipment [trunk lines]
- --- Nuclear power control equipment
- --- Medical and other life support equipment (e.g., scuba).

• If the SHARP devices listed in this publication fall within the scope of strategic products described in the Foreign Exchange and Foreign Trade Law of Japan, it is necessary to obtain approval to export such SHARP devices.

• This publication is the proprietary product of SHARP and is copyrighted, with all rights reserved. Under the copyright laws, no part of this publication may be reproduced or transmitted in any form or by any means, electronic or mechanical, for any purpose, in whole or in part, without the express written permission of SHARP. Express written permission is also required before any use of this publication may be made by a third party.

 $\cdot$  Contact and consult with a SHARP representative if there are any questions about the contents of this publication.